

# LARGE STROKE ELECTRONIC INDICATORS

DATA  
OUTPUT


2117-100PE/1001PE




- Button function: on/off, zero, mm/inch, data preset, tolerance, change measuring direction, max./min./TIR measurement, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off
- Maximum measuring force: .719lbf
- Data output
- Optional accessory: data output cable (part no. 7315-50M, 7302-40M, 7305-40M), backs (page 74), contact points (page 73)



2117-100E

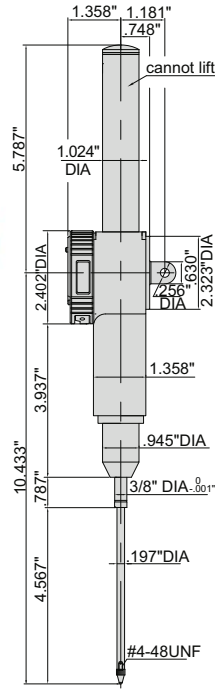

2117-100PE

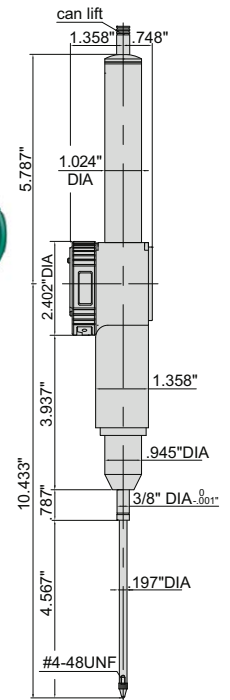


Resolution .0005"/0.01mm

Part No.	Range	Accuracy	Hysteresis	Remark
2117-100E	4"/100mm	±.0015"	.0005"	lug back
2117-100PE	4"/100mm	±.0015"	.0005"	flat back, with lift cap

Resolution .00005"/0.001mm

Part No.	Range	Accuracy	Hysteresis	Remark
2117-1001E	4"/100mm	±.00030"	.0001"	lug back
2117-1001PE	4"/100mm	±.00030"	.0001"	flat back, with lift cap

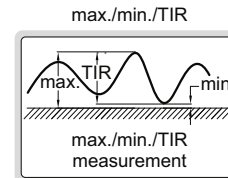

spindle lift knob is included

