



# PRECISION BORE GAGES

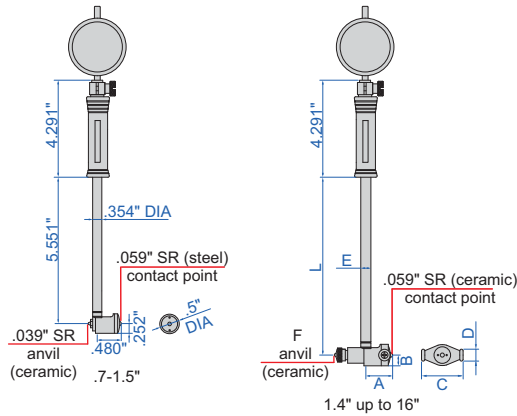


- Optional accessory: setting ring (part no. 6313), bore gage setter

Range	A	B	C	D (DIA)	E (DIA)	F	L
1.4-2.4"	.866"	.354"	1.063"	.512"	.504"	.079" R	5.551"
2-6"	1.024"	.354"	1.378"	.512"	.504"	.079" R	5.551"
6-10"	2.224"	.512"	2.933"	.591"	.571"	.079" R	9.488"
10-16"	3.406"	.591"	3.996"	.591"	.571"	.098" R	9.488"

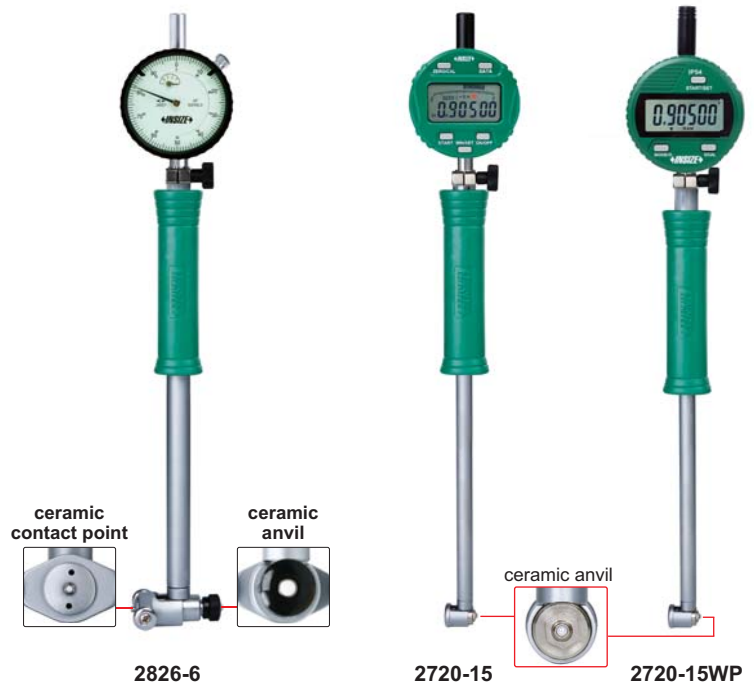

## With dial indicator


Part No.	Range	Indicator	Accuracy	Repeatability
2826-15	.7-1.5"	dial indicator, range .05", graduation .0001" (part no. 2315-05)	±.0003"	.00006"
2826-24	1.4-2.4"		±.0003"	.00006"
2826-4	2-4"		±.0003"	.00006"
2826-6	2-6"		±.0003"	.00006"
2826-10	6-10"		±.0003"	.00006"
2826-16	10-16"		±.0003"	.00006"

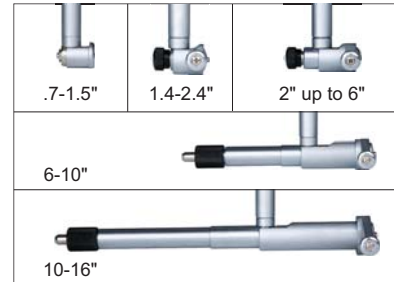

## With digital indicator

(data output cable part no. 7315-50M page 5, 7302-40M page 13, optional)

Part No.	Range	Indicator	Accuracy	Repeatability
2720-15	.7-1.5"	digital indicator, part no. 2108-101EF, range .5"/12.7mm, resolution .00005"/0.001mm	±.0003"	.0001"
2720-24	1.4-2.4"		±.0003"	.0001"
2720-4	2-4"		±.0003"	.0001"
2720-6	2-6"		±.0003"	.0001"
2720-10	6-10"		±.0003"	.0001"
2720-16	10-16"		±.0003"	.0001"

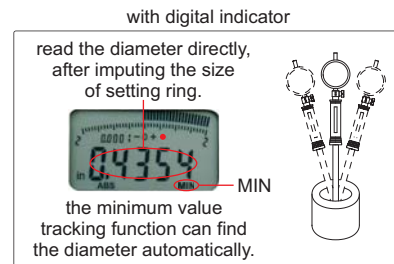

## With waterproof digital indicator

(data output cable part no. 7315-50M page 5, 7302-40M page 13, optional)

Part No.	Range	Indicator	Accuracy	Repeatability
2720-15WP	.7-1.5"	waterproof digital indicator, part no. 2137-101EF, range .5"/12.7mm, dust/waterproof IP54, resolution .00005"/0.001mm	±.0003"	.0001"
2720-24WP	1.4-2.4"		±.0003"	.0001"
2720-4WP	2-4"		±.0003"	.0001"
2720-6WP	2-6"		±.0003"	.0001"
2720-10WP	6-10"		±.0003"	.0001"
2720-16WP	10-16"		±.0003"	.0001"

